

Technical Service Bulletin

Nov 5, 2021

A14MKII – Version 3.02 Software Release

The A14MKII software has been updated to include bug fixes and improvements as listed below.

Release Type

 Maintenance	Major	Critical
--	-------	----------

Software Information

New Version	V3.02
Previous Version	V3.01

Serial Number (Change will be effective in units start from the serial numbers listed below.)

Black	266-122-1001
Silver	766-122-1001

Release Notes

- Optimized the volume ramp design and improved consistency performance between Phono and Line / Digital Stages.

For more information or questions please contact your customer service representative.

-- End --

Technical Service Bulletin

Aug 16, 2021

A14MKII - Auto Power Down Reliability Improvement

The release below includes details of a hardware modification, to improve the reliability of Auto Power Down function.

Release Type		
Maintenance	Major	Critical

Software Information	
Version	V3.02

Serial Number (Change will be effective in units start from the serial numbers listed below.)	
Black	266-122-1001
Silver	766-122-1001


Release Notes

Change one a ceramic cap in associated circuit around APD detecting OP AMP from **22pF/50V** to **100pF/50V** per each model in according.

Location: C417

Current Part: 043TC50V220D-02 R/CERAMIC CAP **50V22PF** J3 220D 1H NPO S53C

New Part: 043TC50V101-02 R/CERAMIC CAP **50V100PF** J3 101K 1H Y5P S53C

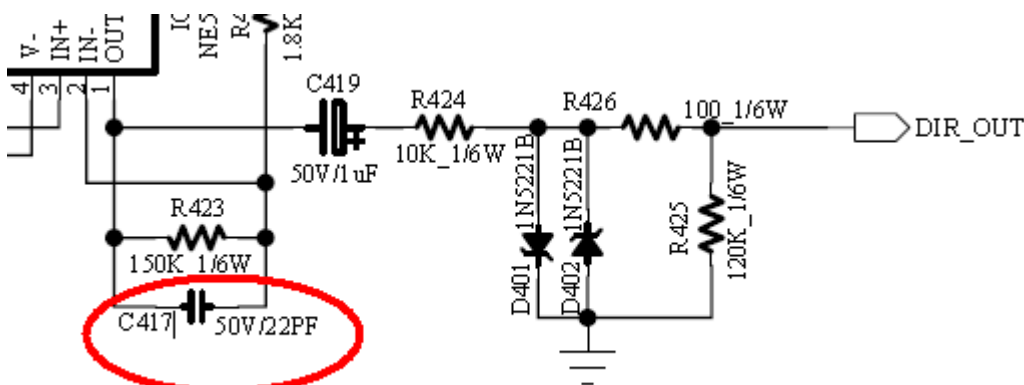

For more information or questions please contact your customer service representative.

-- End --